

Section 10	Section 11
T09N-R02W	T09N-R02W
Richland	Richland

WITNESS MONUMENT TIES:

- MAG nail and shiner in hack 0.8' above grade in the north side of a 17.5" hackberry; N84°W 3.8'
- MAG nail and shiner in hack 0.6' above grade in the west side of a 4" walnut; S0°E 25.2'
- MAG nail and shiner in hack 0.6' above grade in the southeast side of a 13" cherry; S60°W 27.6'
- MAG nail and shiner in hack 0.9' above grade in the west side of a 5" maple; N10°E 17.1'
- MAG nail and flagging found 0.5' above grade in the east side of 11" utility pole #765-824; N30°W 33.5'
- Cut "X" in east manhole rim; N15°E 28.7'

MONUMENT ACCESSORIES:

(#203) 5/8" rebar with yellow plastic cap stamped "IND GAS BAUER RLS#80040457" found flush; S82°52'28"W 30.74'

OTHER ACCESSORIES:

A 5' steel t-post was set 2.9' above grade S10°W 0.9' from the pipe. A Monroe County Survey Marker sign was set 2.2' above grade on the north side of the post, facing the pipe.

There is an orange carsonite "Smithville Buried Phone Line" post 0.7' west of the pipe.

NOTES:

- Field work was performed on September 12, 2017.
- Monroe County Surveyor's Field Book 50, page 71.
- Project Name: Rich_Q07, Field work by: RSO & MCB, Drawn by: RSO, Reviewed by: RSO & TER.
- Coordinates shown hereon were obtained from GPS observations utilizing the Indiana Real-Time Network (INCORS). Indiana West Zone, NAD83(2011) Epoch 2010.0000, State Plane Grid Coordinates, US Survey Feet. Geoid model G2012BU7. Datum NAD83_NO_TRANS.
- Coordinate data was collected using a Topcon PG-A1 antenna and a Topcon GRS-1 data collector. Vicinity sketch compiled per 2017 aerial photography. Distances to witness ties were collected with a 100' cloth tape. Bearings to witness monument ties were measured with a 2° compass adjusted for declination and are approximately shown hereon for reference. Priority should be given to provided distances over bearings. Bearings provided between found monuments are grid north (Indiana State Plane West Zone).
- We visited this monument outside of our regular maintenance and evaluation schedule because of a citizen concern. Witness "C" from the 1998 recovery tie drawing is shown hereon as Witness "E", none of the other old witnesses were recovered. Historic research was not performed to prove the validity of this monument. This monument was accepted by the Monroe County Surveyor Review Board on June 4, 1998.

▲ **Monument Description:** 1-1/4" o.d. Iron Pipe found 1.0' below grade
State Plane Grid Coordinates: Northing: 1450749.1', Easting: 3086371.9'

SHEET
1
OF
2

MONUMENT RECORD
 CORNER ID:
RICH_Q07

Quarter Corner
 Sections 10 & 11 - T09N-R02W
 Richland Township
 Monroe County, Indiana



OFFICE OF THE MONROE COUNTY SURVEYOR
 Trohn Enright-Randolph Monroe County Surveyor
 Rachel Savich Oser Professional Surveyor
 119 West 7th Street, Bloomington, IN 47404 (812) 349-2570



(Photos were taken on 09/12/2017 with an iPhone 6S)



Looking northeast at Rich_Q07




Trohn Enright-Randolph
 Trohn Enright-Randolph
 Monroe County Surveyor



Accepted by the Monroe
 County Surveyor Review Board
 on November 21, 2017



Rachel Oser
 Rachel Savich Oser, State of Indiana
 Professional Surveyor No. 21100022

SHEET 2 OF 2	MONUMENT RECORD CORNER ID: RICH_Q07	Quarter Corner Sections 10 & 11 - T09N-R02W Richland Township Monroe County, Indiana	 OFFICE OF THE MONROE COUNTY SURVEYOR Trohn Enright-Randolph Monroe County Surveyor Rachel Savich Oser Professional Surveyor 119 West 7th Street, Bloomington, IN 47404 (812) 349-2570
-----------------------	---	--	--

MONUMENT RECORD
State of Indiana - County of Monroe

Section: 11


Township: 9 North

Range: 2 West

Corner ID: Rich Q-07



Monument Description & Remarks: Found 1¼" o.d. Iron Pipe, 8" underground, at West ¼ corner of section.
Note: good corner to re-monument.

References on file in the County Surveyor's Office:

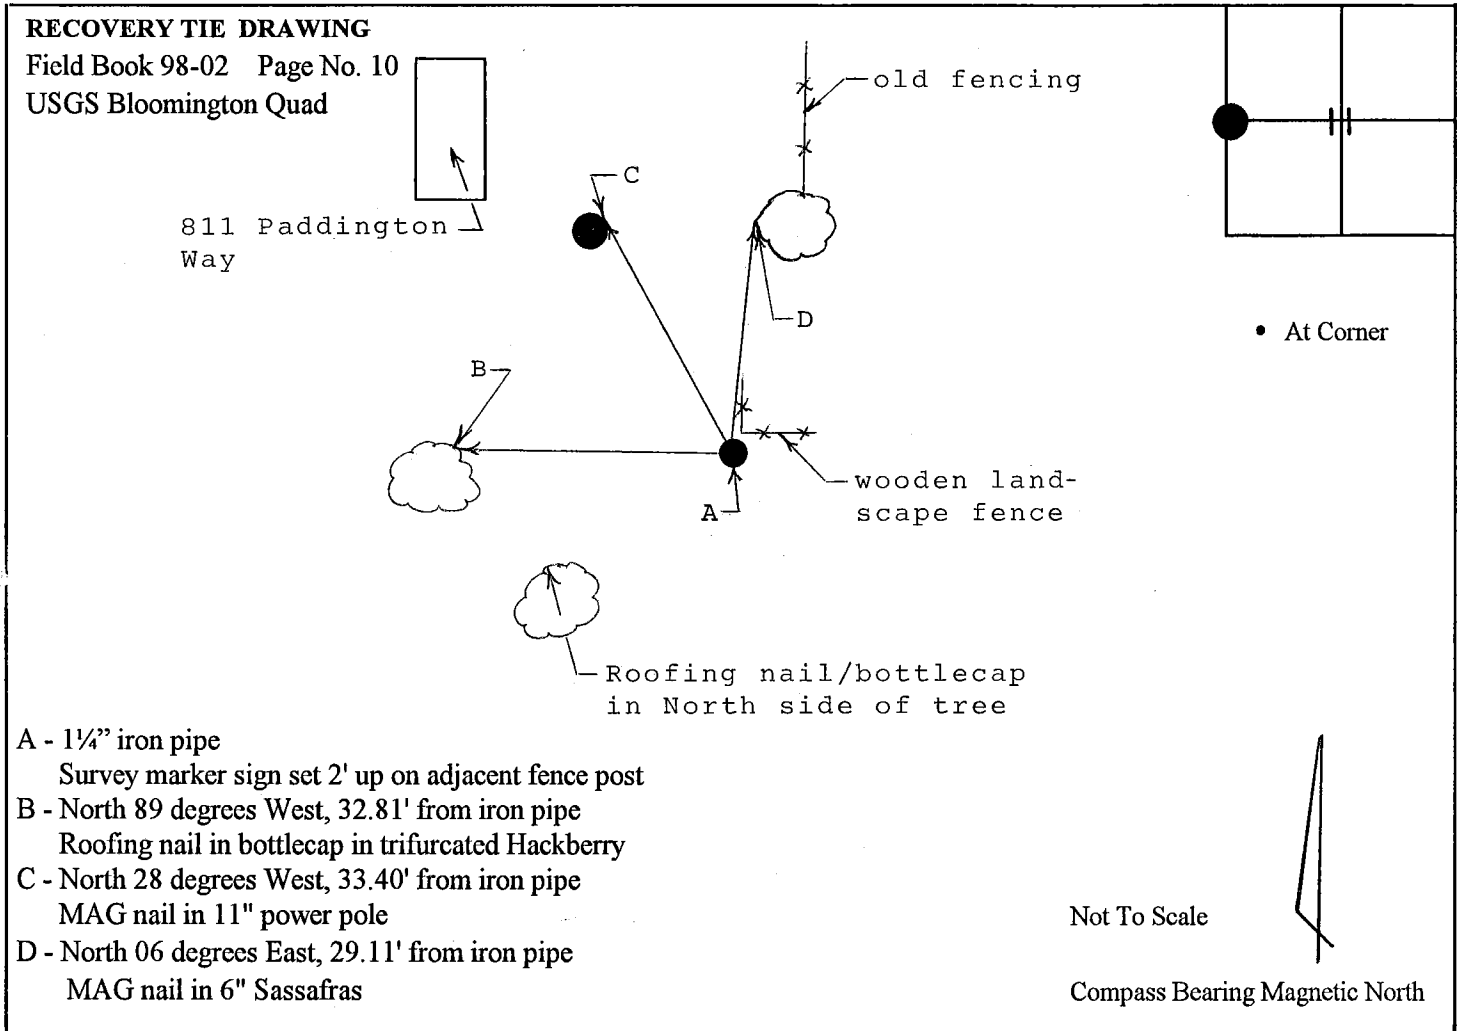


I, Kevin P. Enright, Monroe County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of Section 36-2-12 of the Indiana Code; and the above data is given under my hand and seal this 4th day of June, 1998.

Administered by Surveyor Review Board

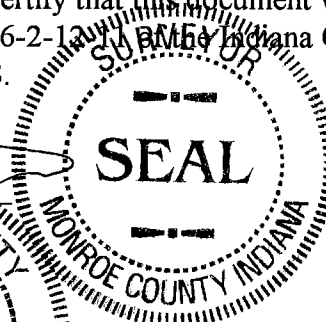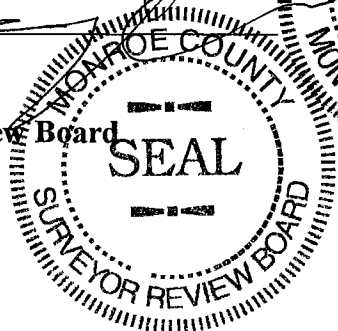

S.E. COR OF N.E 1/4
Sec. 10, T-9-N, R-2-W
RICHLAND, TWP, MONROE CO.

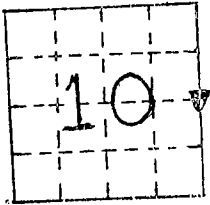

Type Monument 1" I. PIPE
Depth 4" Deep
By SURVEY PTY # 3
Date MAY 11, 1989

